


Mark the string 1/16" above square. This will be the location of the bottom of the arrow (not the nock).



A nocking loop is the preferred method, but a nock set can also be used. When installing a loop, make sure that the ends of the loop terminate on opposite side of the string as shown in the illustration.

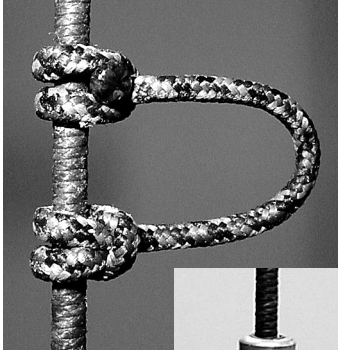


Nocking loop with ends terminating on opposite sides of string.



Nock sets can also be used


STEP 4: MOUNTING SIGHT

As a starting point, mount the sight of your choice in the center set of mounting holes on the side of the riser. If your sight is equipped with a built-in level, use it to adjust the sight so that it is level. Next, adjust the sight so that the pins line up with the string with the string centered on the arrow as shown in the illustration.

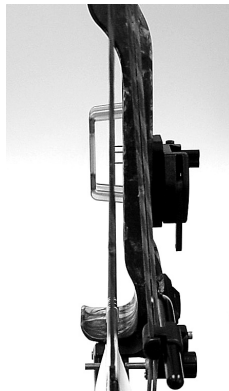

STEP 5: INSTALL PEEP

In the approximate location of where the peep will finally be, tie a series of about 10 half-hitch knots on the string with the appropriate waxed string. About an inch above, tie another series of about 10 half-hitch knots. Then place the bow in a bow press to relax the string. Insert a string splitter or similar device between the green and brown strands of the string and insert the peep. Clip the excess ends of the string and singe the ends carefully with an open flame. Slide the peep sight up or down to move the peep to the proper level for your personal shooting position.

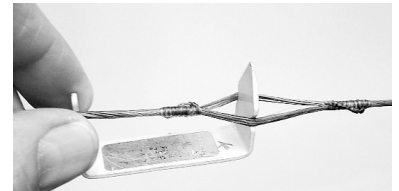

Install the peep tube by wetting one end with alcohol and sliding it onto the peep. Tie the other end to the cable nearest the string.

